

Release Notes for DrayTek VigorSwitch P2100 (UK/Ireland)

Firmware Version	2.9.10 (Formal Release)
Release Type	Important – Review release notes and upgrade if the changes affect your system stability, performance, or security
Build Date	12 th June 2026
Release Date	30 th June 2026
Build Revision	e17971d
Loader Version	2.1.0
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

1. Improved the CGI security
2. Updated OpenSSL from v3.6.0 to v3.6.3, incorporating the latest security patches and fixes
3. Added support for including the device hostname in DHCP Option 12 when sending DHCP requests
4. Corrected an issue where a DHCP Server IP interface with the Pool Count set to 1021 generated an error and could not be saved
5. Corrected an issue where the switch rebooted when clearing the Protected Host Table while the MAC table contained a large number of entries
6. Corrected an issue where stale MAC/ARP entries remained on the L3 switch after an HA VIP failover, causing traffic to be forwarded to the previously active node
7. Corrected an issue where intermittent L3 VLAN routing failures caused end devices to lose connectivity under high network load when using the switch as their default gateway

Known Issues

1. Users can't downgrade the firmware below 2.8.x, if the loader version is 3.5.2
To check the loader version, open the Dashboard page or use this CLI command:
show info

Notes

1. STP (Spanning Tree Protocol) has been enabled by default since firmware version 2.9.8, which may affect the time it takes for ports to come up
-

Firmware Version	2.9.9 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	16 th January 2026
Release Date	13 th March 2026
Build Revision	133954f
Loader Version	3.5.2
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

8. The number of supported VLANs set to 512
9. The syslog format prevented VigorACS from collecting logs correctly
10. Applying an empty port description profile in Central Management did not clear the existing switch settings

Known Issues

2. Users can't downgrade the firmware below 2.8.x, if the loader version is 3.5.2
To check the loader version, open the Dashboard page or use this CLI command:
show info

Notes

2. STP (Spanning Tree Protocol) has been enabled by default since firmware version 2.9.8, which may affect the time it takes for ports to come up
-

Firmware Version	2.9.7 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	6 th March 2025
Release Date	9 th May 2025
Build Revision	59996db
Loader Version	3.5.2
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

1. Improvements to the Web GUI security
2. Improvements to the DNS domain registration with TR-069 service

Known Issues

1. Users can't downgrade the firmware below 2.8.x, if the loader version is 3.5.2
To check the loader version, open the Dashboard page or use this CLI command:
show info

Firmware Version	2.9.5 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	15 th July 2024
Release Date	23 rd October 2024
Build Revision	ef29dcb
Loader Version	3.5.2
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

1. Improvements to the TR-069 parameter related issues
2. The CPU usage mechanism improvements

Known Issues

1. Users can't downgrade the firmware below 2.8.x, if the loader version is 3.5.2
To check the loader version, open the Dashboard page or use this CLI command:
show info

Firmware Version	2.8.3 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	10 th January 2023
Release Date	21 st March 2023
Build Revision	a452dac
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

1. Further improvements to the Web GUI
2. The PoE chip driver upgrade
3. [System Maintenance] > [General] > [Firmware] page can now display the latest firmware version available online
4. Improvements to the renew certificate mechanism

Firmware Version	2.8.0 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	13 th May 2022
Release Date	04 th August 2022
Build Revision	c286e45
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

1. Support the new PoE chip driver

Improvements

1. Improved Web GUI Security
2. Updated HTTPS mechanism to address the CVE-2022-0778 (OpenSSL)
3. The HTTPS management port can be edited
4. The MVR Group Count has been increased to 512 [Switch LAN] > [Multicast] > [MVR]
5. Number of entries for the ICP (IP Conflict Prevention) and ICD (IP Conflict Detection) table has been increased to 1024
6. Port Bandwidth Utilization page's colours match the Dashboard
7. The RADIUS settings disappeared after restarting the switch
8. The status information of the SFP optical module improvements
9. The VLAN interface uplink TPID setting could not be stored by the switch

Firmware Version	2.6.8 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	08 th June 2021
Release Date	11 th August 2021
Build Revision	bf398b9
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

1. Added support for DHCP relay
2. [DHCP] > [Bind IP to MAC] .csv file format is now supported for storing the configuration

Improvements

(none)

Firmware Version	2.6.7 (Formal Release)
Release Type	Regular – Upgrade recommended when convenient
Build Date	03 rd February 2021
Release Date	16 th April 2021
Build Revision	1960
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

New Features

(none)

Improvements

1. Updated MyVigor authentication method

Firmware Version	2.6.5 (Formal Release)
Release Type	First Firmware Release
Build Date	27 th August 2020
Release Date	16 th March 2021
Build Revision	1941
Applicable Models	VigorSwitch P2100
Locale	UK & Ireland Only

First Firmware Release

[END OF FILE]